




REVISIONS			DETAILS
0	A	MAR 86	ECO 4K/161 REPLACES BRESS CARD
1	A	29 JAN 80	ECO 4K/184 TR1-4 EXITTERS CONN TO FILTERED POWER SUPPLY
2	A	29 JAN 80	ECO 4K/236 O/P HYBRIDS WERE 265502A1 NOW 265502A2 R72/76/80 WERE 15K NOW 17K2 R71/75/79 WERE 15K NOW 13K7 CAP PAIRS C35/36 C37/38 40/41 42/43 C15/16 47/48 WERE 2 X 220U NOW 1 X 220U
3	A	29 JAN 80	ECO 4K/268 R69,70/73/74/78 WERE TO -18V NOW TO 0V, DE POLARITY REVERSED ON SILK SCREEN
4	A	13 FEB 80	ECO 4K/516 R63 WAS 8K8 NOW 5K0
5	A	12 SEPT 80	ECO 4K/603 B.O.M. AMENDED TO INCORPORATE JK REV PCB
6	A	31 MAR 82	ECO 4K/910 R61 R62 WERE 10K NOW 2A FUSE. RA HWS 15K RESISTOR PACK NOW DISCRETE 4K7 & 15K. LINKS LK23-24 NOW FITTED
7	A	7 MAY 82	ECO 4K/952 R61 WAS 100K NOW 10K R72 R76 R80 WERE 17K2 NOW 27K4
7	B	13 APR 83	CIRCUIT CORRECTION LINKS TO LINKS WERE TWO POSITION LINKS NOW ONE POSITION
8	A	5 MAY 83	ECO 4K/1131 H1 H2 WERE NOT FITTED NOW FITTED

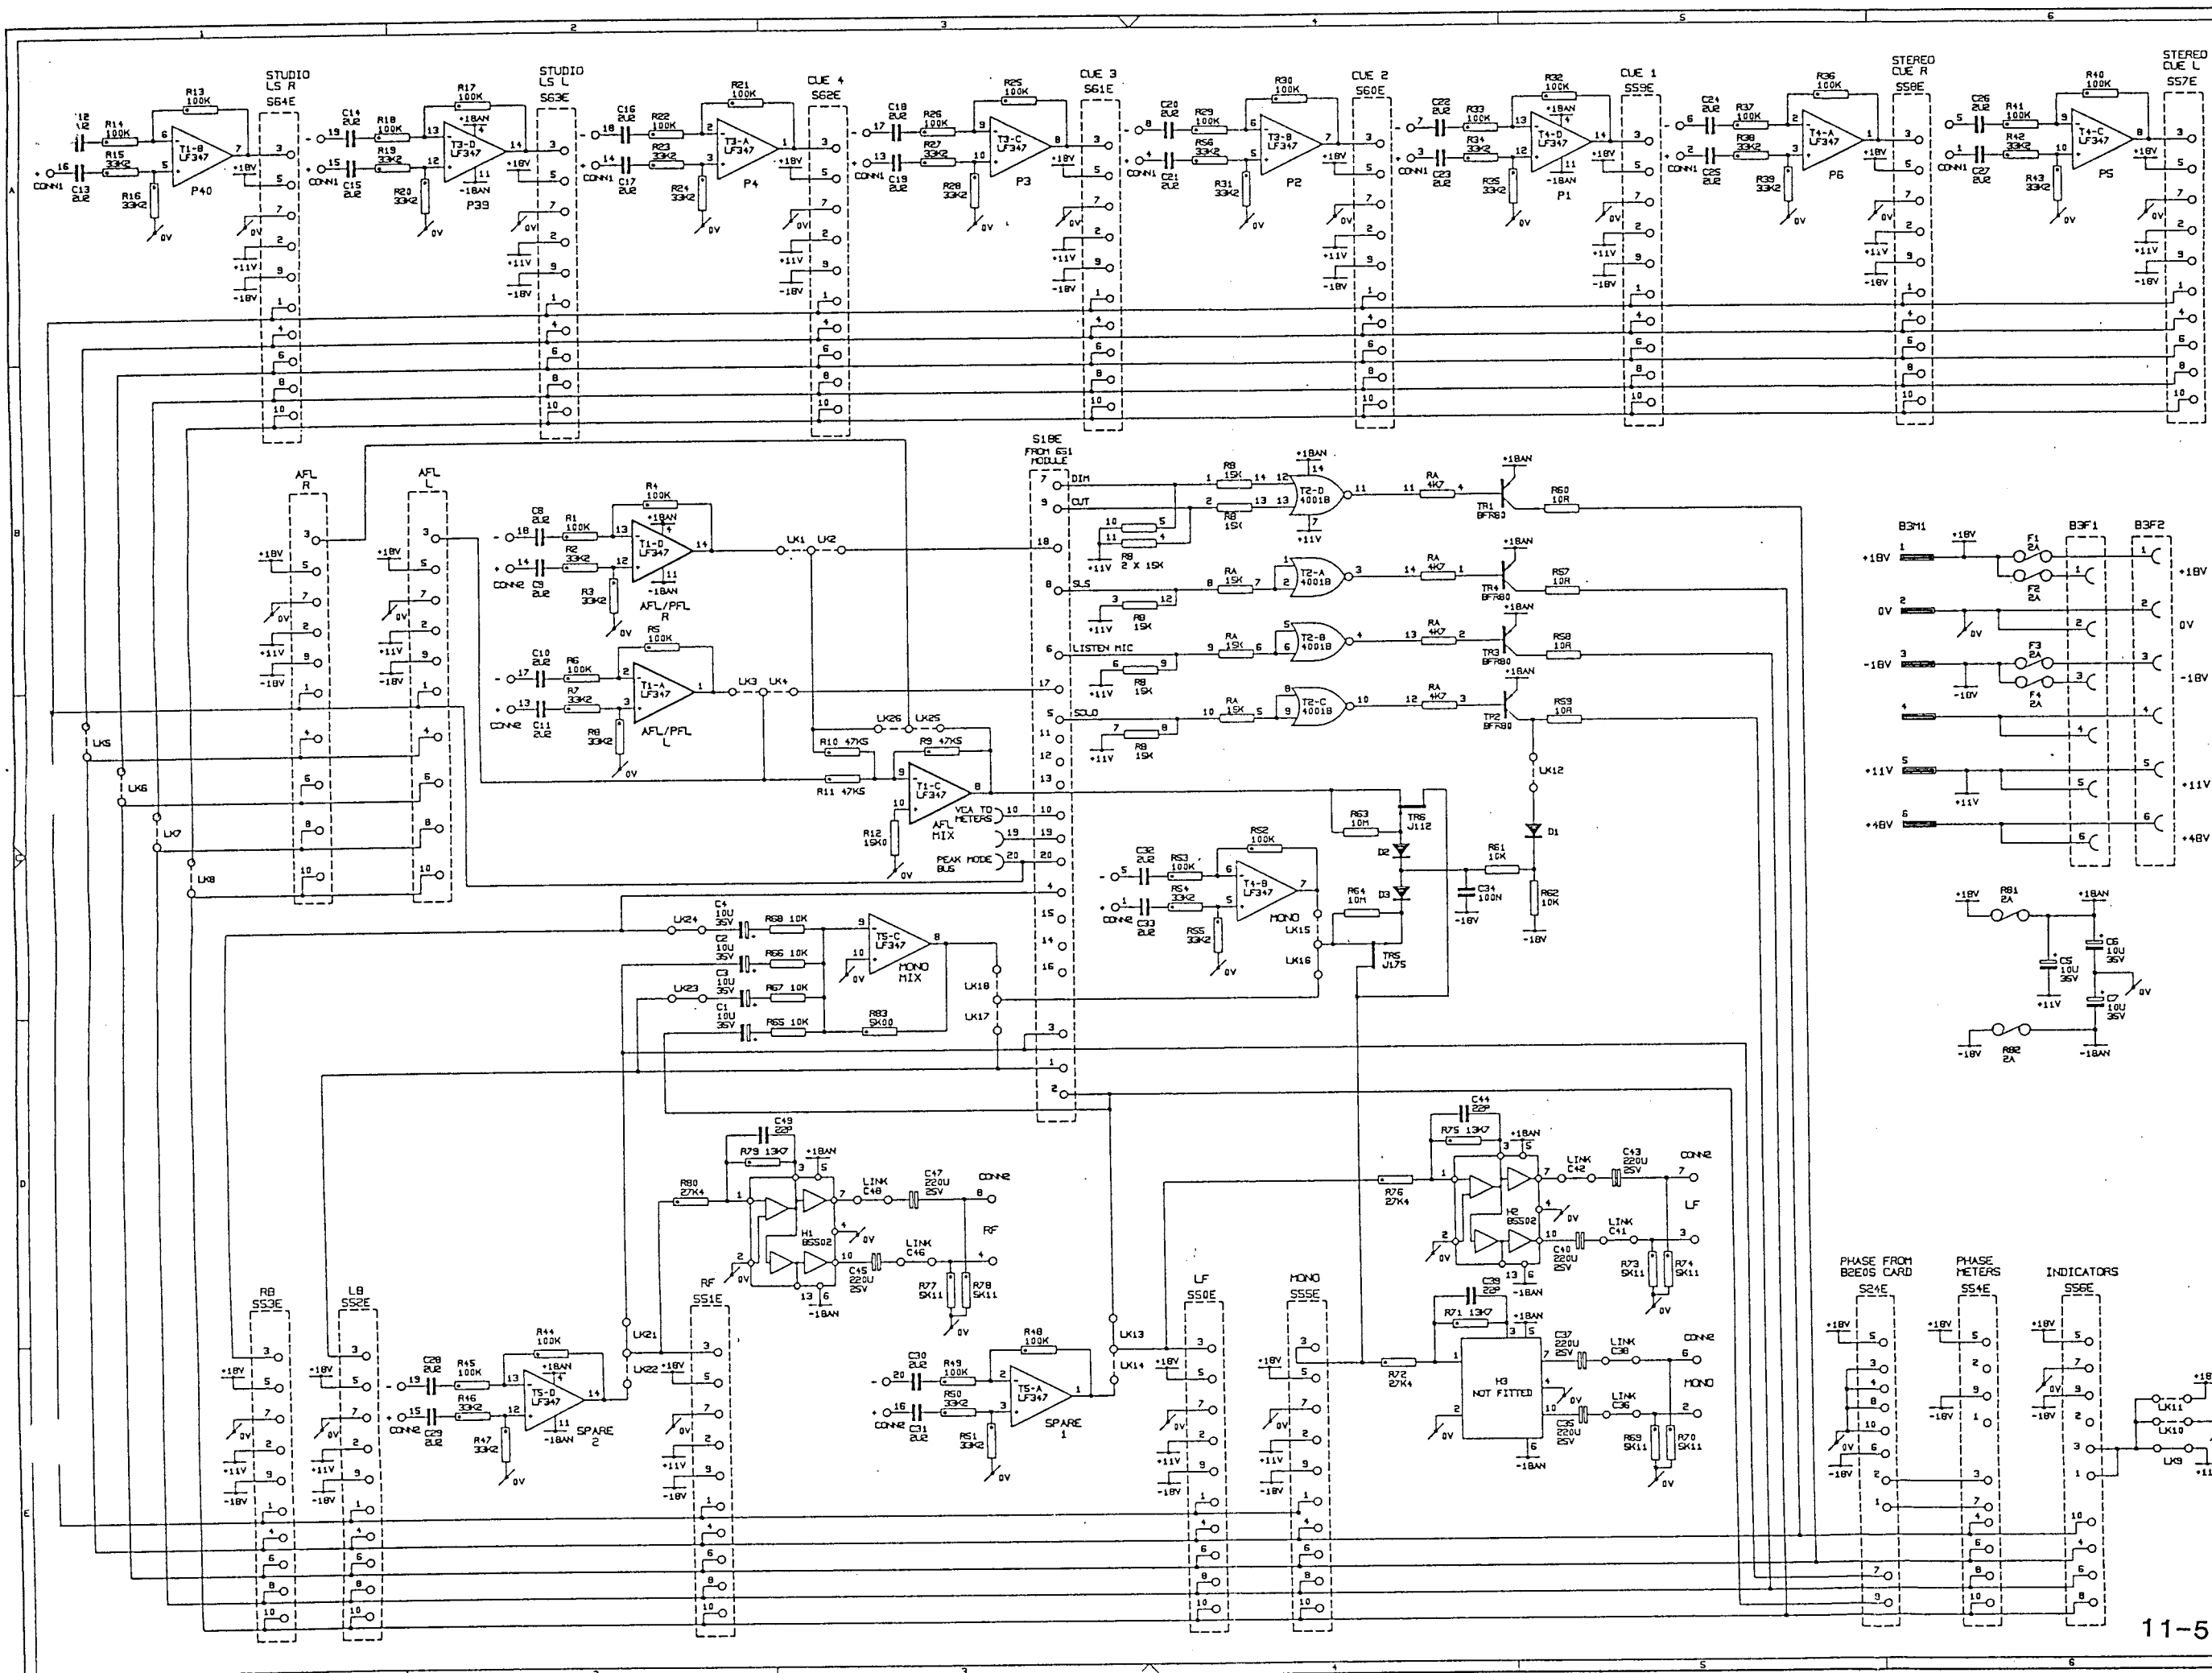